

Status Report on Breakdowns (Urban / Rural)

Urban

S.No	Circle	No.of Feeders Existing Urban		Breakdowns occurred during the day		Attended during the day		Time taken for restoring the supply				Remarks (Pending)
		33KV	11KV	33KV	11KV	33KV	11KV	Rectified (Within 24 Hours)		Not Rectified (Above 24 Hours)		
								33KV	11KV	33KV	11KV	
1	MBN	18	107									
2	NLG	22	358									
3	MDK	97	359									
4	SDPT											
5	RR(S)	53	234		1		1		1			
6	RR(N)	54	550		2		2		2			
7	RR(E)	168	403		4		4		4			
8	Hyd	194	1044		79		79		79			
	Total	606	3055	0	86	0	86	0	86	0	0	

Rural

S.No	Circle	No.of Feeders Existing Rurals		Breakdowns occurred during the day		Attended during the day		Time taken for restoring the supply				Remarks (Pending)
		33KV	11KV	33KV	11KV	33KV	11KV	Rectified (Within 24 Hours)		Not Rectified (Above 24 Hours)		
								33KV	11KV	33KV	11KV	
1	MBN	107	849	5	1	5	1	5	1			
2	NLG	144	988		7		7		7			
3	MDK	107	933									
4	SDPT				7		7		7			
5	RR(S)	58	396									
6	RR(N)	38	114									
7	RR(E)	22	133									
	Total	476	3413	5	15	5	15	5	15	0	0	
	Grand Total	1082	6468	5	101	5	101	5	101	0	0	

TSSPDCL - LMRC / Corporate office

Date: 09.10.2020

S.No	Circle	Name of 132/33KV SS	Name of 33 KV Feeder	Vol	Name of the Division	From	To	Duration	Relay Indication	Cause of Breakdown	Sub Stations Effected	Alternate Supply Arranged
1	MBNR	Balanagar	Rajapur	33KV	Jadcherla	14.25	15.50	01.25	E/L	33KV Insulator Replacement at Polepally	Rajapur	No
2		Midjil	Madaram	33KV	Jadcherla	17.40	20.40	03.00	E/L	Pin Binding Replacement & 5Nos Insulator Replacement at Malapur X Raod	Madaram	No
3		Kothur	Sangem	33KV	Rajendernagar	17.10	19.22	02.12	E/L	33KV Insulator Failed at Aryam Steel Company	Sangem	No
4		Kothur	Thimmapur	33KV	Rajendernagar	16:50	19:28	2:38	E/L	33KV Insulator Failed at Penjarla Raod	Thimmapur	No
5		Sri Rangapur	Utharaspally	33KV	Rajendernagar	17.58	19.27	01.29	E/L	Tree Fallen on the 33KV Line	Utharaspally	No

S.No	Circle	Name of 33/11KV SS	Name of 11 KV Feeder	Vol	Name of the Division	From	To	Duration	Relay Indication	Cause of Breakdown	Alternate Supply Arranged
1	MBNR	APPAKPALLY	APPIREDDYPALLY	11KV	Narayanapet	01.15	07.20	06.05		DUE TO SQUIRREL FALLEN ON 11KV LINE, CONDUCTOR SNAPPED,	No
1	NLG	Reddygudem	Maddirala	11KV	Suryapet	9:30	12:00	2:30	EL	Insulator failed	No
2		Sirikonda	Balluthanda	11KV	Huzurnagar	13.20	15.00	01.40	EL	11 KV LINE SNAPPED	No
3		N B Gudem	Redlakunta	11KV	Huzurnagar	09.00	10.30	01.30	EL	11 KV LINE SNAPPED	No
4		Addagudur	Dharmaram	11KV	Bhongir	03.00	09.20	06.20	EL/OL	11 KV Disc failed at SS- 1 near Laxmidevikaluva village.	No
5		Gundala	Gangapur	11KV	Bhongir	04.30	11.00	06.30	EL/OL	11 KV Insulator failed at SS-3 near Marripadiga village.	No
6		Yennaram	Suraram	11KV	Choutuppal	06.32	12.10	05.38	EL/OL	11 kv Line snapped near Bachuppl village	No
7		Vemulakonda	Chitthapuram	11KV	Choutuppal	14:35	16:20	1:45	EL/OL	11 kv Disc failed at ss-1 near Chittapuram village	No
1	SDPT	Akkannapet	Akkannapet Rural	11KV	Husnabad	11:20	16:37	5:17		Insulator blast	No
2		Dharmaram	Dharmaram(R.)	11KV	Husnabad	08.30	14.34	06.04		11 kv line cutting	No
3		Bekkal	Kutigal	11KV	Husnabad	11.30	14.15	02.45		AB Switch problem	No
4		Dhoolmitta	Bekkal	11KV	Husnabad	09.14	10.25	01.11		Tree fallen in line	No
5		Marmamula	Salakpoor	11KV	Husnabad	08.30	09.30	01.00		Tree fallen in line	No
6		Ahmedipur	Pediched	11KV	Gajwel	18:30	18:40	00.10		Insulator failure	No
7		Kondapaka	Vishvanathapally	11KV	Gajwel	11:30	15:15	3:45		Insulator failure	No
1	RR S	IIIT	IVRCL	11KV	Gachibowli	18:08	20:15	2:07		11kv Pin Insulator failed near Good Governance.	No